as of: 1-31-2017 Data from: PB and BZ


CONGRESS STREET - TOWN OF BATH SIDEWALK EVALUATION

Street	Sidewalk Map No.	Corner Map Letter	Evaluated Condition Code	Condition Found (Missing Sections; warped; steps/drops; patches; <4 ft wide)	Complies w/ADA Stds?	Notes
	1, 2, 3 etc	A, B, C etc	G-Y-R	MS-W-S/D-P-<4'	Ramps/Material	Status in Streetscapes Plans
		Α	G	No deterioration; fairly new 1-way Corner Ramp	Yes	Done in Streetscapes Phase # ??
Congress	1		R	Warped; steps & drops; patches	No	Planned for replacement in Phase 4
		С	G	New Install in Ph 3; 2-way ramps	Yes	Completed in Phase 3
		В	R	End ramps match to street level; no ADA provisions	No	Planned for replacement in Phase 4
Congress	2		R	Warped; steps & drops; patches	No	Planned for replacement in Phase 4
		D	Υ	Older ADA design; 1-way ramp to Congress x-walk only	Partial	Planned for replacement in Phase 4
	15 a	E-1	G	New Install in Ph 3; 2-way ramps	Yes	Completed in Phase 3
Congress	3a		R	Surface badly deteriorated - Rte 522 to Bridge; Bridge walkway is about 4 ft wide; uses wood planks on edge	No	Planned for replacement in Phase 4
		E-2	R	No ADA Ramp adjascent to bridge	No	Planned for replacement in Phase 4
		G-1	R	No ADA Ramp to Bridge & no connection to existing sidewalk	No	Planned for replacement in Phase 4
Congress	3b		R	Sidewalk is not continuous; some concrete, but also grass	No	Planned for replacement in Phase 4
		G-2	Y	ADA Ramp is 1-Way to cross Congress St only; Power Pole is obstruction within ADA ramp area	Partial	Planned for replacement in Phase 4
		F-1	Υ	Existing ADA Ramp is 1-way only to Cross Congress St	Partial	Completed in an Earlier Phase; review for Phase 4
Congress	4a		G	Sidewalk appears in good condition; ends at Library driveway.	Yes	Library parking lot provides ADA access to library building
		F-2	Υ	As above; S/W ends at Drive. There is no sidewalk on this side of Congress going over the Bridge at the Run	Partial	Planned for review and/or replacement in Phase 4
		H-1	R	As above, there is no sidewalk on this side of the Bridge and no ADA ramp back to the questionable sidewalk coded "4b"	No	Planned for review and/or replacement in Phase 4
Congress	4b		R	Some sidewalk West of Mercer St; then no real S/W across outside seating area for Ice Cream Shop	No	Planned for review and/or replacement in Phase 4
		H-2	G	Existing 1-way ADA Ramp	Yes	Completed in an Earlier Phase; review for Phase 4
		Ĭ	R	Corner is flush with Fire Dept parking lot on both Mercer and Congress Sts. There is no S/W in this area	No	Planned for review and/or replacement in Phase 4
Congress	5		R	Very little sidewalk on this side of Congress; Fire Dept lot; drive to industrial bldg and narrow S/W with steps/heaves near Green St		Planned for review and/or replacement in Phase 4
		к	R	No ADA ramps		Planned for review and/or replacement in Phase 4
		J	R	No ADA ramps	NO I	Planned for review and/or replacement in Phase 4
Congress	6		R	Sidewalk is steep up-hill, steps & drops; adjacent tree	NO	Planned for review and/or replacement in Phase 4
		L	R	No ADA ramps		Planned for review and/or replacement in Phase 4

as of: 1-31-2017 Data from: PB and BZ

Identification & Coding of Sidewalks & Corners

Sidewalk Assessment by Streets & Blocks Congress St (Wilkes to N. Green St)

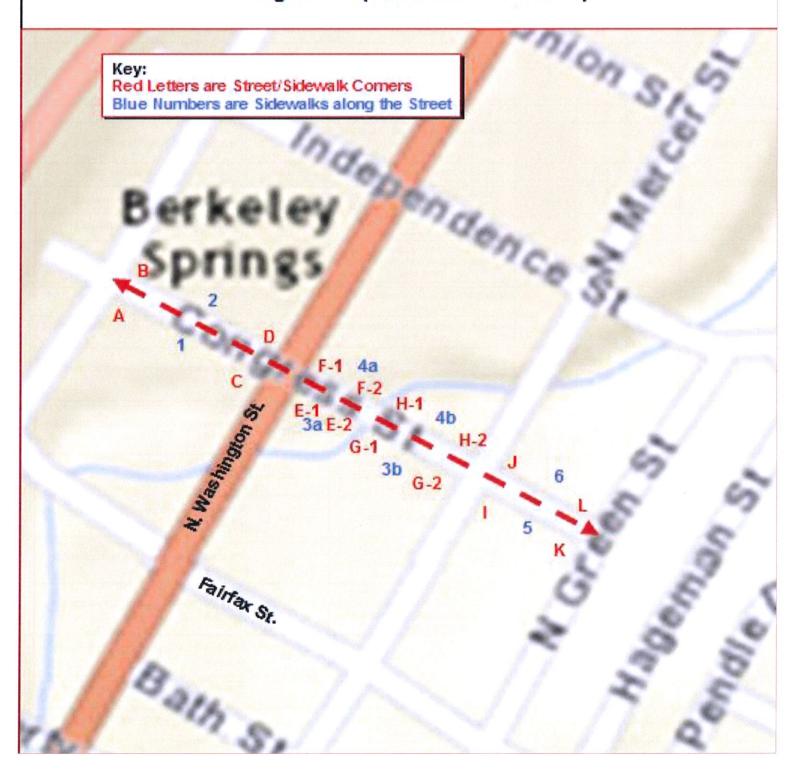


Color Coding of Results

Sidewalk Assessment by Streets & Blocks

Congress St (Wilkes to N. Green St)


Color Coding of Results

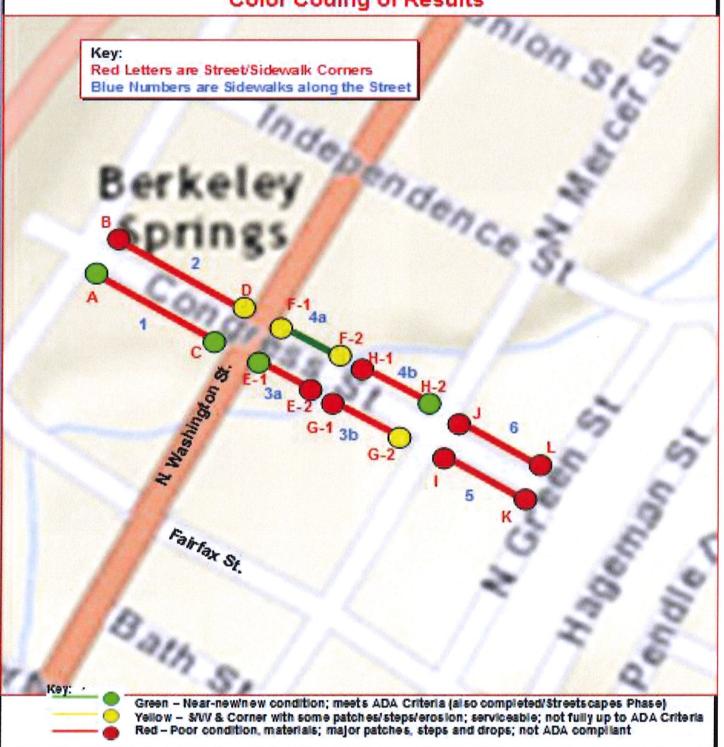



3A


as of: 1-31-2017 Data from: PB and BZ

PHOTOS OF SPECIFIC AREAS

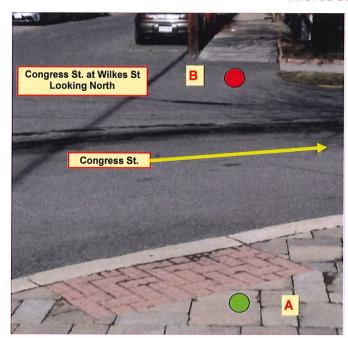

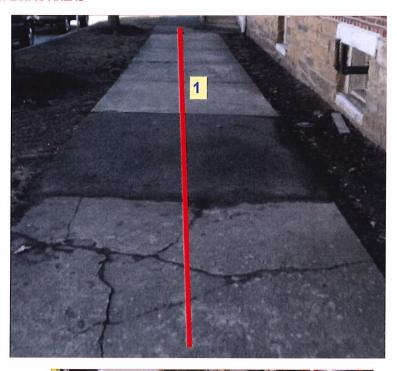


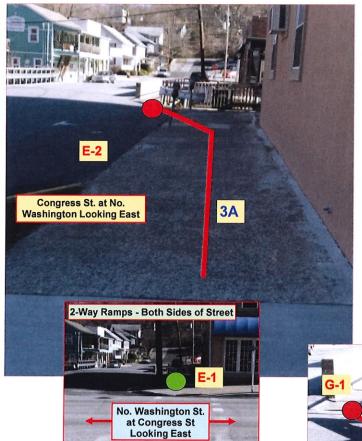

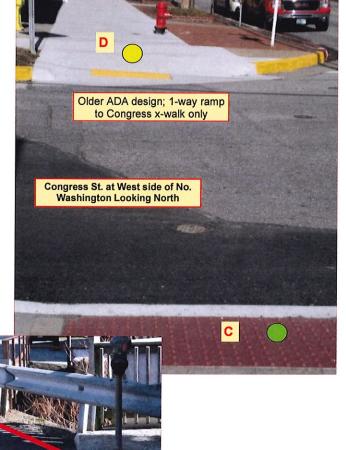


CONGRESS STREET - TOWN OF BATH SIDEWALK EVALUATION

as of: 1-31-2017 Data from: PB and BZ

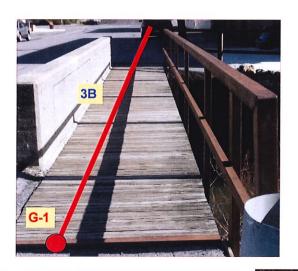



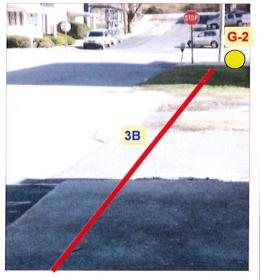





Congress St - Bath Sidewalk Evaluation

CONGRESS STREET - TOWN OF BATH SIDEWALK EVALUATION

as of: 1-31-2017 Data from: PB and BZ