

MARTINSBURG ROAD - TOWN OF BATH SIDEWALK EVALUATION

Street	Sidewalk Map No.	Corner Map Letter	Evaluated Condition Code	Condition Found (Missing Sections; warped; steps/drops; patches; <4 ft wide)	Complies w/ADA Stds?	Notes
	1, 2, 3 etc	A, B, C etc	G-Y-R	MS-W/S/D-P-<4'	Ramps/Material	Status in Streetscapes Plans
		A	R	Curb drops off from height of 4-5 inches	No	Conflict with vehicles ingress/egress to Sheetz
Martinsburg Rd	1		R	No sidewalk. Dangerous for pedestrians	No	This Block has no sidewalk and only a narrow shoulder from the roadway
		C	R	No improvements	No	
		B	R	No improvements. Service station paving goes from corner to corner.	No	Conflict with vehicles ingress/egress to Roy's
Martinsburg Rd	2		Y	First half is poor, but the second half has been recently improved to Mercer St	Partial	First half is red. Second half is green
		D	G	One way access across Mercer with DWS	Yes	
		E	R	No improvements	No	
Martinsburg Rd	3		R	4' sidewalk cracked and uneven. Gravel needs to be removed. Residents park on sidewalk and shoulder.	No	A small portion near the east end is in good shape but deadends into a power pole
		G	R	No improvements	No	
		F	G	One way access across Mercer with DWS	Yes	
Martinsburg Rd	4		G	New sidewalk	Yes	
		H	G	Sidewalk wraps around to Green St and provides accessible crossing there.	Yes	While there is good access across Green St, there is no access across Martinsburg Road
		J	R	The new sidewalk has a paved ramp onto Dawson St.	No	This is a dangerous crossing for pedestrians
Martinsburg Rd	6		R	No improvements	No	Parking along Martinsburg Rd conflicts with any pedestrian use on the north side of street
		L	R	No improvements	No	

Identification & Coding of Sidewalks & Corners

Sidewalk Assessment by Streets & Blocks

Martinsburg Rd (So. Washington to Coffee Shop)

Key:
Red Letters are Street/Sidewalk Corners
Blue Numbers are Sidewalks along the Street




Color Coding of Results

Sidewalk Assessment by Streets & Blocks

Martinsburg Rd (So. Washington to Coffee Shop)

Key:
 Red Letters are Street/Sidewalk Corners
 Blue Numbers are Sidewalks along the Street

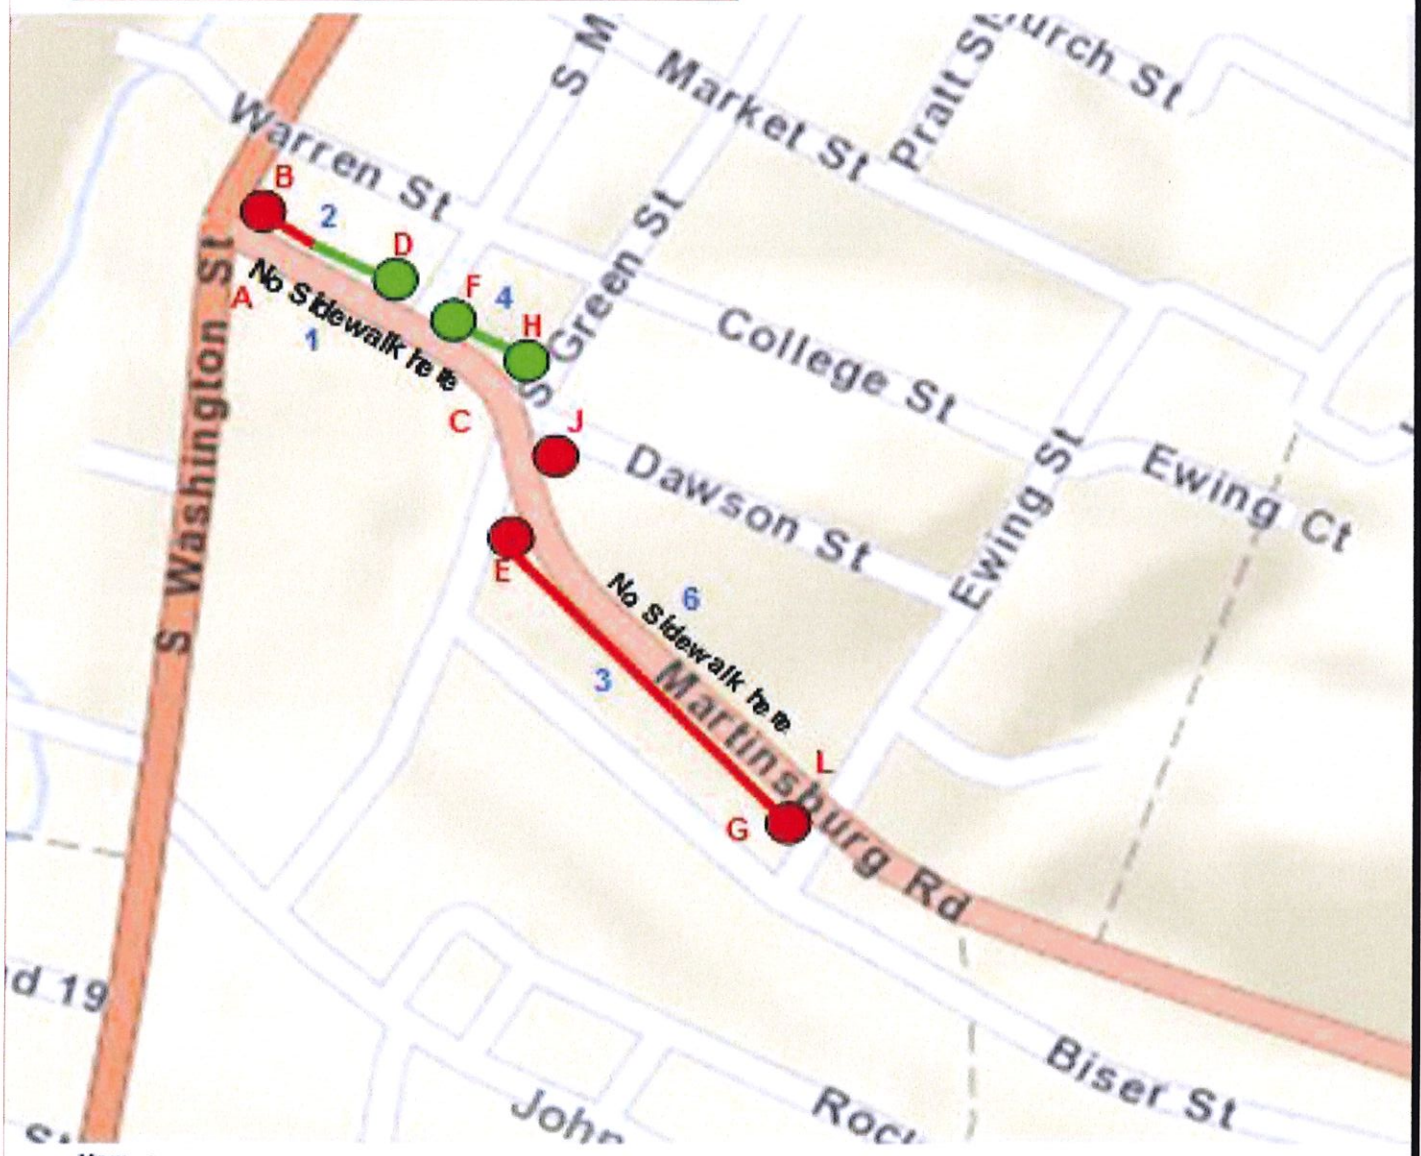

Key:

- Green - Near-new/new condition; meets ADA Criteria (also completed/streetscapes Phase)
- Yellow - S/V & Corner with some patches/steps/erosion; serviceable; not fully up to ADA Criteria
- Red - Poor condition, materials; major patches, steps and drops; not ADA compliant

MARTINSBURG ROAD - TOWN OF BATH SIDEWALK EVALUATION

PHOTOS OF SPECIFIC AREAS

